
Flow monitoring Immersion sensor with integrated processor FCS-N1/2A4P-ARX-B3141/115VAC



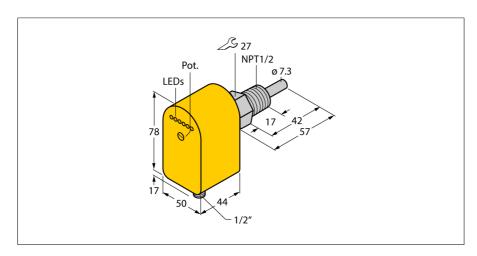

., pe accignation	
Ident-No.	6871037
Ident-No (TUSA)	M6871037
Mounting	Immersion sensor
Water Operating Range	1150 cm/s
Oil Operating Range	3300 cm/s
Stand-by time	typ. 8 s (215 s)
Switch-on time	typ. 2 s (115 s)
Switch-off time	typ. 2 s (115 s)
Temperature jump, response time	max. 12 s
Temperature gradient	< 250 K/min

FCS-N1/2A4P-ARX-B3141/115VAC

Temperature gradient

✓ 250 K/min

Medium temperature

-20...+80 °C

Operating voltage

Output function

Rated operational current

Short-circuit protection

✓ 250 K/min

-20...+80 °C

Rated operational current

2 A

Short-circuit protection

AC switching voltage 250 VAC
DC switching voltage 60 VDC
Max. AC switching capacity 500 VA
Max. DC switching capacity 50 W
Protection class IP67

Type designation

Housing material Plastic, PBT

Sensor material Stainless steel, V4A (1.4571)

Max. tightening torque housing nut30 NmElectrical connectionConnector, 1/2"Pressure resistance100 barProcess connectionNPT ½"

Switching state LED chain green / yellow / red

Flow state display

Indication: Drop below setpoint

Indication: Setpoint reached

Indication: Setpoint exceeded

LED yellow

Indication: Setpoint exceeded

4 x LEDs green

- Flow sensor for liquid media
- Calorimetric principle
- Adjustment via potentiometer
- LED band
- Flange connector: Mini-Brad Harrison
- AC 4-wire, 98...132 VAC
- NO contact, relay output
- Plug-in device, 1/2"

Wiring Diagram



Functional principle

Our insertion - flow sensors operate on the principle of thermodynamics. The measuring probe is heated by several °C as against the flow medium. When fluid moves along the probe, the heat generated in the probe is dissipated. The resulting temperature is measured and compared to the medium temperature. The flow status of every medium can be derived from the evaluated temperature difference. Thus TURCK's wear-free flow sensors reliably monitor the flow of gaseous and liquid media.