


K50RPLPGXDQ Pick-to-Light – Placement Sensor Retroreflective Sensor with Polarizing Filter

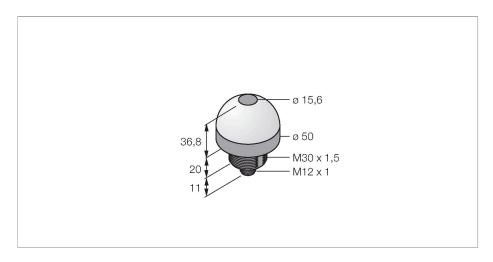


Technical data


Туре	K50RPLPGXDQ	
ID	3076278	
Signal and display data		
Purpose	Pick-to-Light	
Function	Retroreflective Sensor	
Max. range	2000 mm	
Light type	Red	
Number of beams	1	
Switch Function	Momentary	
Features of color 1	Green, Permanently on	
Special features	I/O module-compatible Wash down	
Electrical data		
Operating voltage U _B	1230 VDC	
DC rated operating current I _e	≤ 150 mA	
Max. current consumption per color	75 mA	
Output function	NC contact, PNP	
Input type	PNP	
Response time typical	< 3 ms	
Mechanical data		
Design	Dome, K50	
Dimensions	Ø 50 x 67.8 mm	
Housing material	Plastic, PC, Black	
Window material	Polycarbonate, diffuse	
Electrical connection	Connector, M12 × 1, PVC	

Features

- ■Protection class IP67
- Male M12 x 1, 4-pin
- ■Job light: green
- Mispick: not signalled
- Actuation: not signalled
- Operating voltage 12...30 VDC
- ■PNP switching
- ■NC contact

Wiring diagram





Functional principle

The K50 pick-and-place sensor is suitable for many mounting and component placement applications. The green work light or other signal lights are reflected perfectly by the entire dome (depending on the version). The transistor output can be easily connected to a system control, which is programmed for a special task sequence. The work light of the sensor is located in or next to every bin at the operator's workstation and indicates: 1. The bins with the components to be picked up for a particular work step and 2. the sequence in which the components have to be picked up. If the operator removes a part from the bin, the K50 detects the hand in the bin and sends a signal to the control unit. The system then checks if the correct component has been picked up and - depending on the configuration - switches the corresponding work light off and the next one on, according to the assembly sequence. The work sequence control leads to increased efficiency, improved quality control and reduces rework and testing expenses. The term work light therefore refers to the visual indicator of the bin from which a part should be removed next. The actuation indicator confirms the removal with a different color. The mispick indicator illuminates if a bin



3052521

Mounting bracket, PBT black, for sensors with 30 mm thread, rotatable

Technical data

was reached into when the work light was not set

Number of cores	4
Ambient temperature	-40+50 °C
Relative humidity	090 %
Protection class	IP67 IP69
Tests/approvals	
MTTF	146 years acc. to SN 29500 (Ed. 99) 40 °C
Approvals	CE, cULus listed


Accessories

SMB30A	3032723	SMB30SC
	Mounting bracket, rectangular, stainless steel, for sensors with 30mm thread	



0 30,5 6,3 wide 0 6,3 38,5 61 7,5

SMB30FA 3074005 Montagewinkel; Werkstoff VA 1.4401

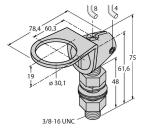

Accessories

Dimension drawing	Type	ID	
M12x1 o 15 14 14 11.5 4 15 50 14	RKC4.4T-2/TEL	6625013	Connection cable, M12 female connector, straight, 4-pin, cable length: 2 m, jacket material: PVC, black; cULus approval
0 15 M12 x 1 26.5 5 14	WKC4.4T-2/TEL	6625025	Connection cable, M12 female connector, angled, 4-pin, cable length: 2 m, jacket material: PVC, black; cULus approval



Accessories

Dimension drawing	Туре	ID	
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	BRT-51X51BM	3071791	Rectangular reflector, reflection coefficient 2.0, material acrylic, ambient temperature -20 +60 °C, microprism geometry
7 7 A	BRT-84	3058979	Round reflector, reflection coefficient 1.4, material acrylic, ambient temperature -20 +60 °C